

TYRE INSPECTION REPORT

 Company: THIESS/EASTERN TRACTORS

 Site: MT THORLEY

 Inspection date : 4/11/2021

 Veh. Make & type: CAT789B




 Fleet : RD0945

Hours : _____

Position	Size	Brand	Tread Spec	Serial Number	Original Tread (mm)	Remaining Tread (mm)	Tyre Condition	Rim / Wheel Number	Tyre Change Priority	Comments
1	42/90R57	B/S	VRDPY	S8K000120		85/80	A	T57-QLD-0232		OK
2	42/90R57	B/S	VRDPY	S9R005564		85/84	A	T57-QLD-2157		OK
3	42/90R57	B/S	VRPS	S7B003968		56/56	C	T57-0970		SIDEWALL DAMAGE NWR
4	42/90R57	B/S	VRPS	S7B005738		58/60	B	CNR		ONLY 1 SIDE INSPECTED AS LAYING ON GRIUND
5	42/90R57	B/S	VRPS	S7B003534		53/54	B	CNR		ONLY 1 SIDE INSPECTED AS LAYING ON GRIUND
6	42/90R57	B/S	VRPS	S7B003749		56/54	C	T57-0968		SIDEWALL CUTS AND DAMAGE BUT OK TO RUN

TYRE CONDITION	
A	GOOD
B	FAIR
C	POOR

Tyre Change Priority	
Urgent	ASAP
Priority 1	Within 1 month
Priority 2	Within 2 months

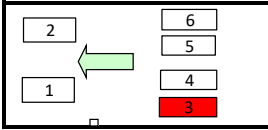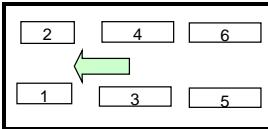

Notes :

POS 3 NWR (BROKEN BODY CORDS-ROCK DAMAGE)
POS 6 SIDEWALL DAMAGE, OK TO RUN BUT LAMINATION WILL CONTINUE TO RUN
POS 3/4 WHEELS WERE LAYING ON GRIUND SO ONLY 1 SIDE WAS INSPECTED BOTH WHEELS LOOKED OK

