

TYRE INSPECTION REPORT

 Company: THIESS/EASTERN TRACTORS

 Site: MT THORLEY

 Inspection date : 4/11/2021

 Veh. Make & type: CAT789B




 Fleet : RD1949

Hours : _____

Position	Size	Brand	Tread Spec	Serial Number	Original Tread (mm)	Remaining Tread (mm)	Tyre Condition	Rim / Wheel Number	Tyre Change Priority	Comments
1	42/90R57	B/S	VRDPY	S9S004113		80/82	A	789-073		OK
2	42/90R57	B/S	VRDPY	S9R001609		86/83	A	QLD-2037		OK
3	37.00R57	B/S	VRLSA	SL003319		40/41	FAIR B	CNR		SIDEWALL CUTS
4	37.00R57	B/S	VRLSA	S8L003661		42/40	FAIR B	CNR		OK
5	37.00R57	B/S	VRLSA	S8K000440		50/50	FAIR B	CNR		CROWN LUG MISSING TO BELTS
6	37.00R57	B/S	VRLSA	S9S001226		52/52	FAIR B	T57-0944		OUTSIDE SIDEWALL CUTS

TYRE CONDITION	
A	GOOD
B	FAIR
C	POOR

Tyre Change Priority	
Urgent	ASAP
Priority 1	Within 1 month
Priority 2	Within 2 months

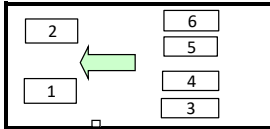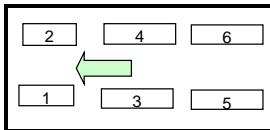


Notes :

FRONTS LOOK OK BUT REARS HAVE SOME DAMAGE (NOT MAJOR)
POS 5 IS THE WORST WITH LUG MISSING TO THE 4TH BELT ON SHOULDER

Position 1



Position 2

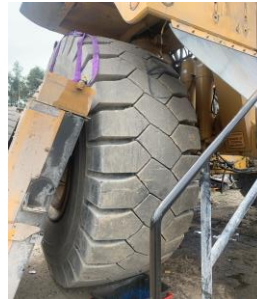

Position 5 DAMAGE



Position 3/4



Position 5/6

